

(4) Input Cables

Figure 2-5 shows the input cable connection diagrams for 2-wire and 4-wire system resistance measurement.

For 2-wire system resistance measurement, use the MI-37 input cables (supplied).

For 4-wire system resistance measurement, use the A01005 input cables (supplied).

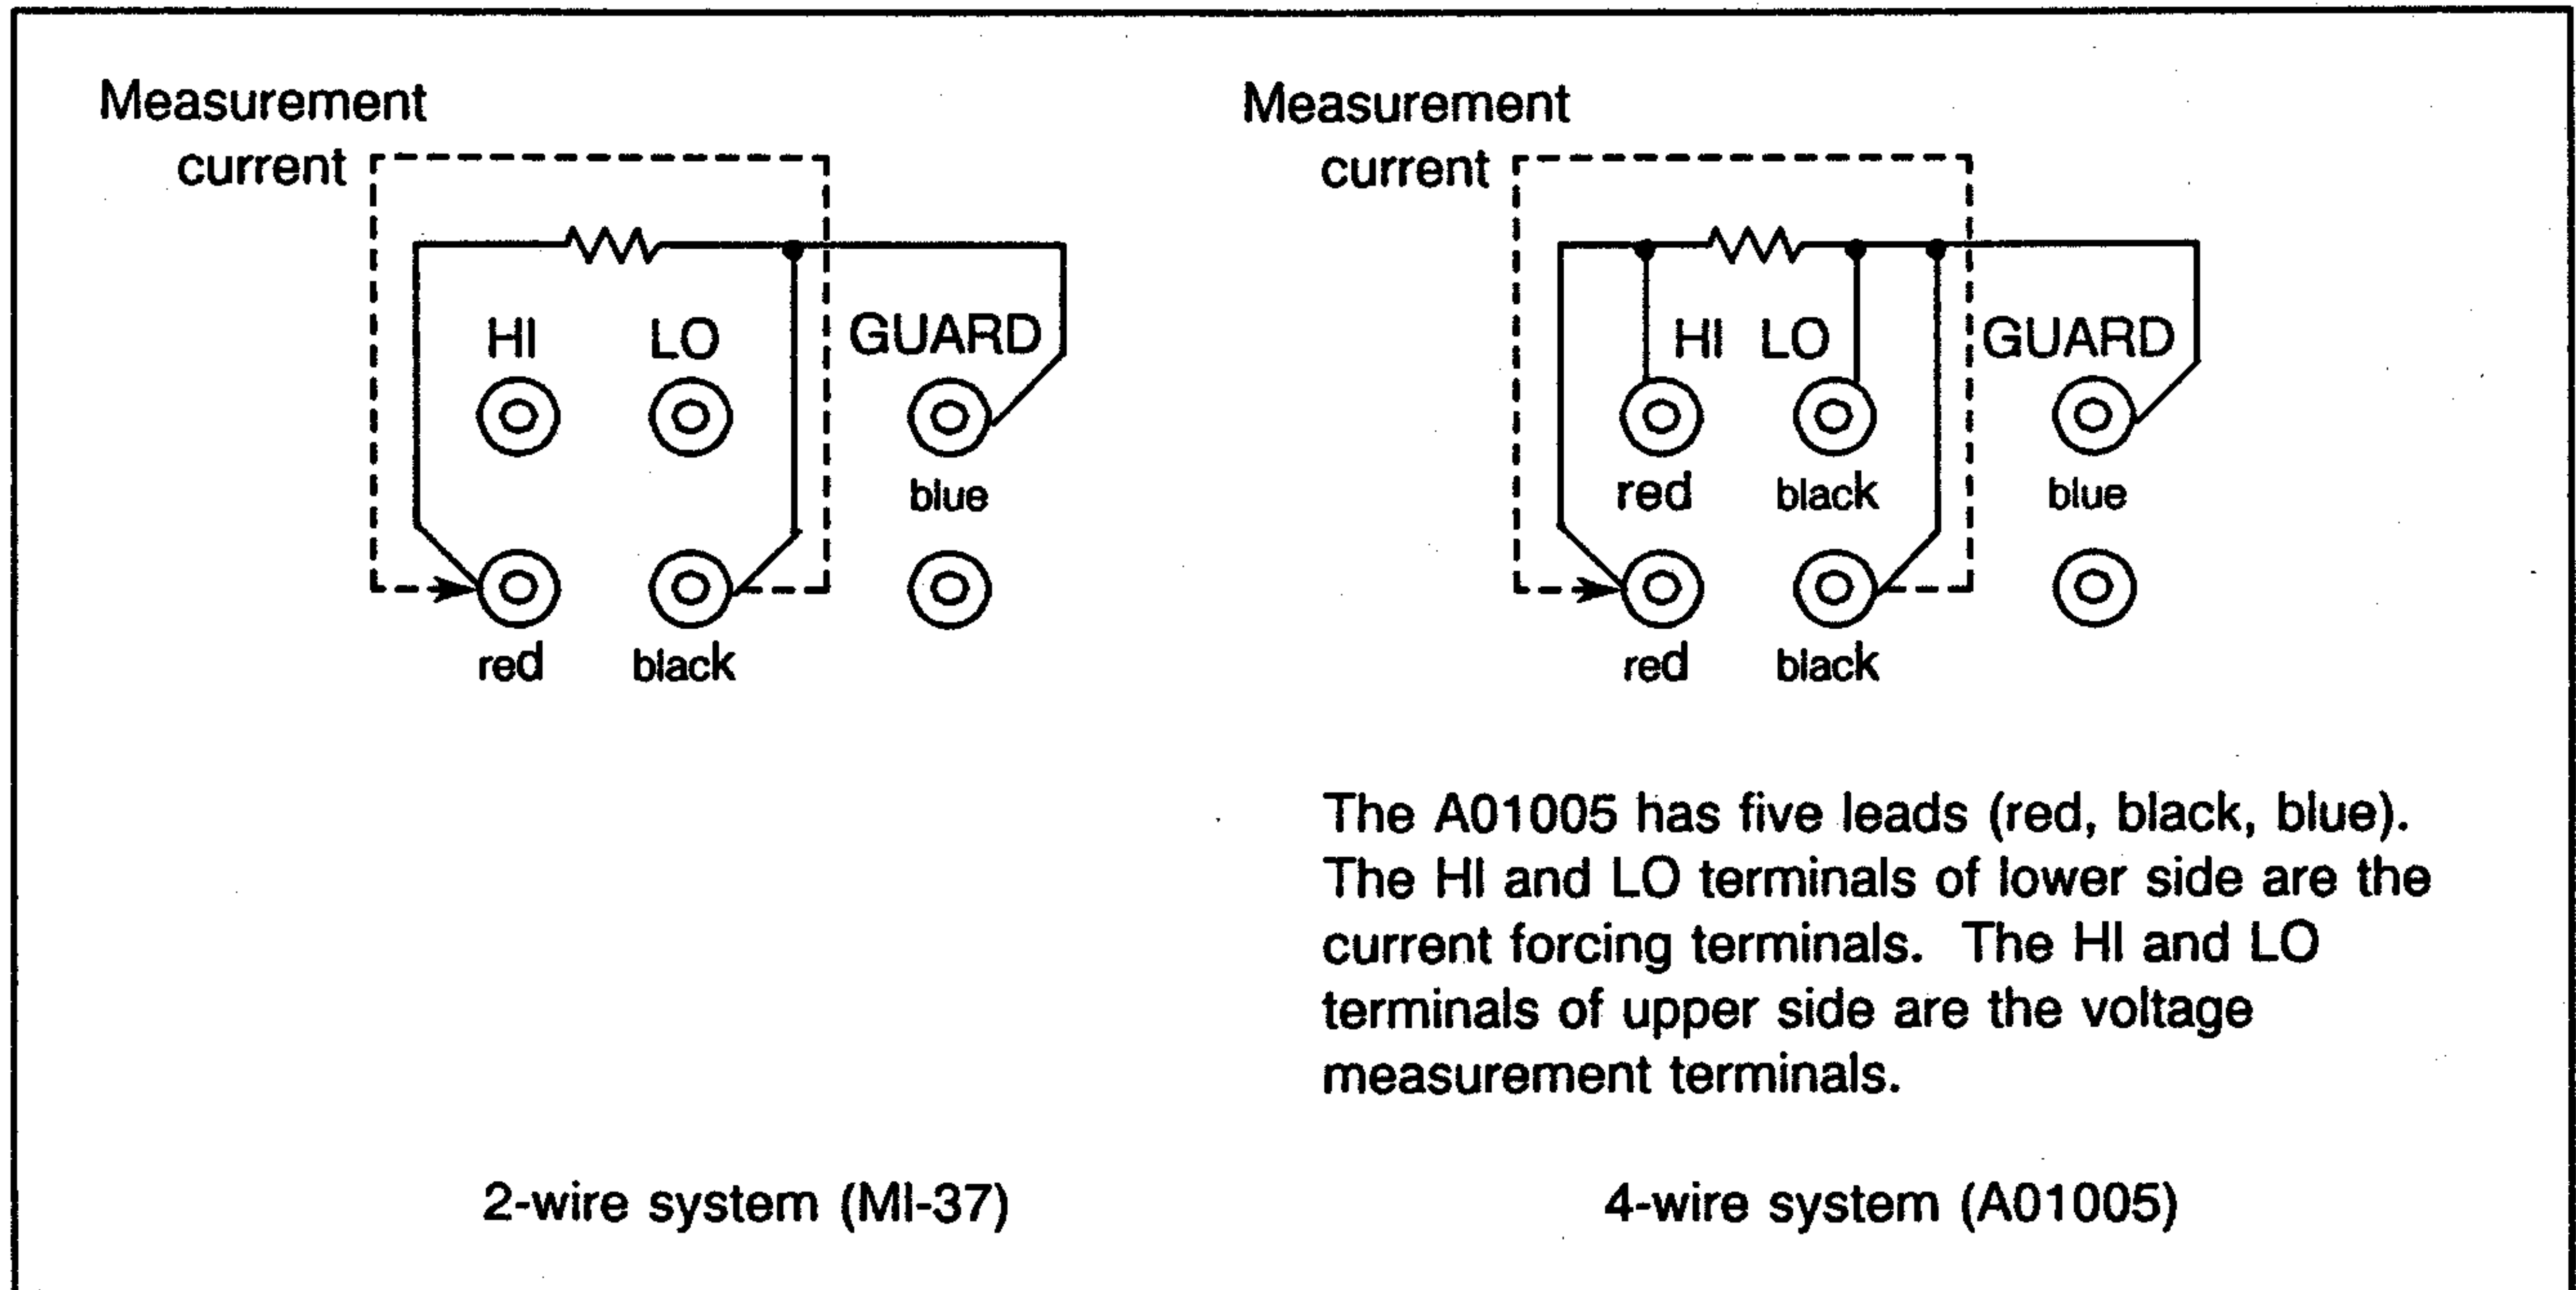


Figure 2-5 Input Cable Connection Diagrams for Resistance Measurement