


W_CN4

2010.11.30


For EMI request W_C53 change from NC to mount, add W_C60

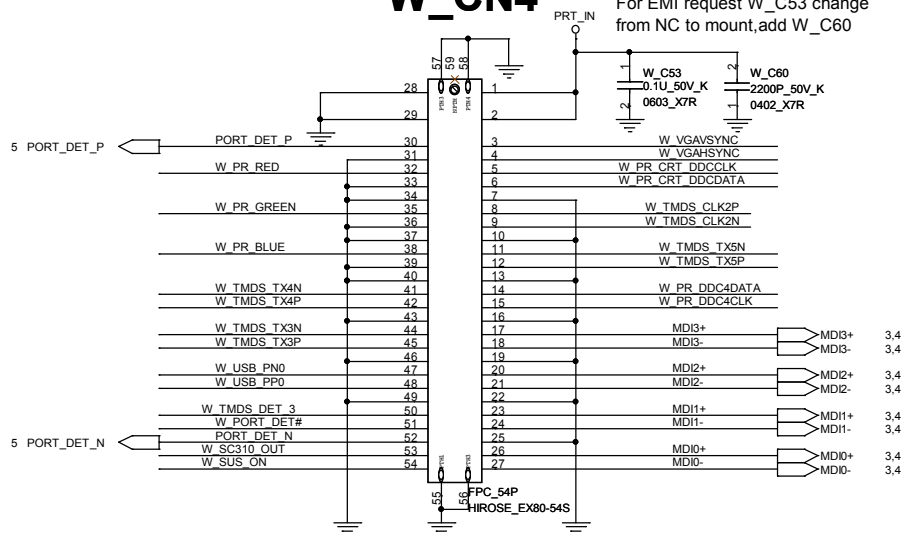

2010.1014(DVT)
For EMI request add W_C58, W_C59


2010.12.01
Move W_F2 to MB

2010.10.26
For PUR suggestion W_C54
W_C55, W_C56, W_C57,
W_C58, W_C59 change from
1C-2N20150-J300 to
1C-2N20150-K000

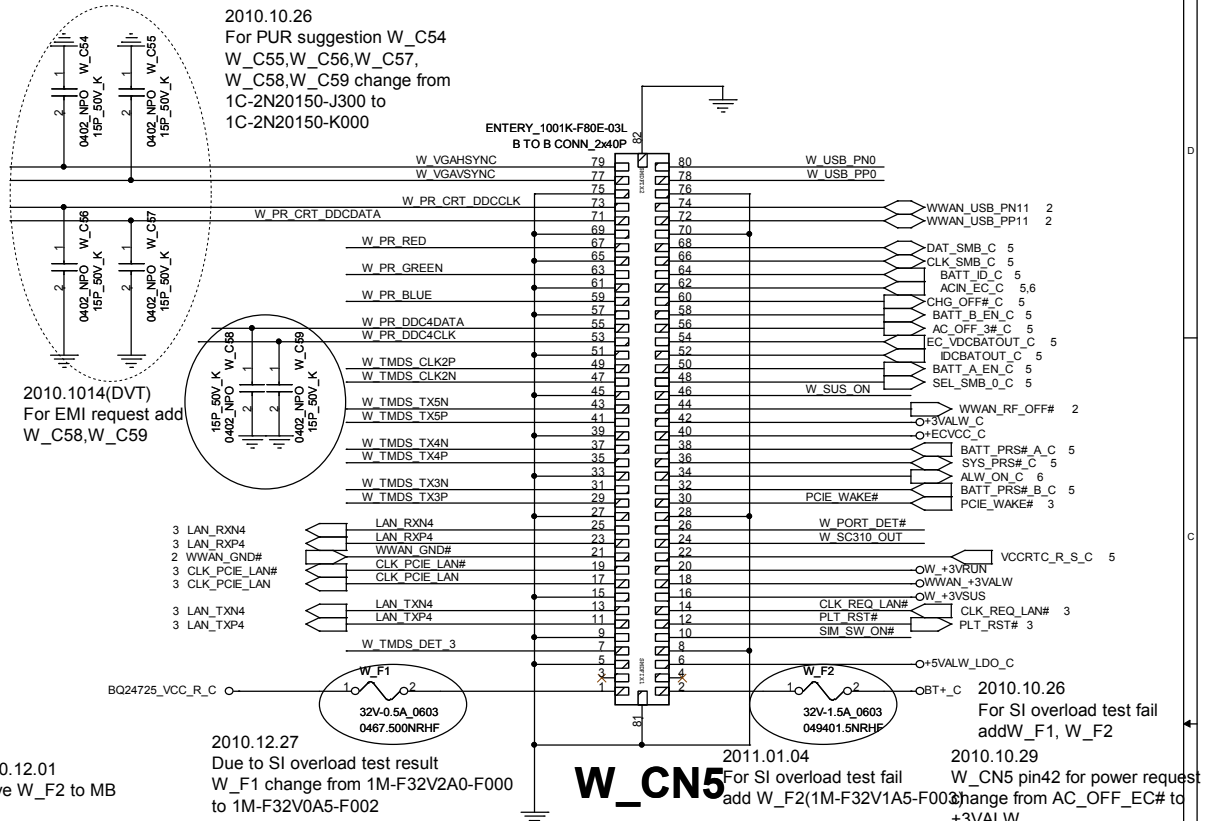


2010.12.27
Due to SI overload test result
W_F1 change from 1M-F32V2A0-F000
to 1M-F32V0A5-F002


2011.01.04
For SI overload test fail
add W_F2 (1M-F32V1A5-F003)
change from AC_OFF_EC# to
+3VALW

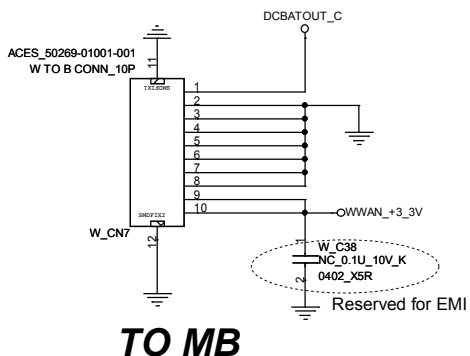


TO MB

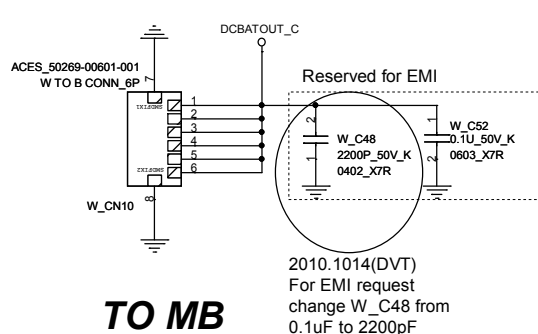


TO MB

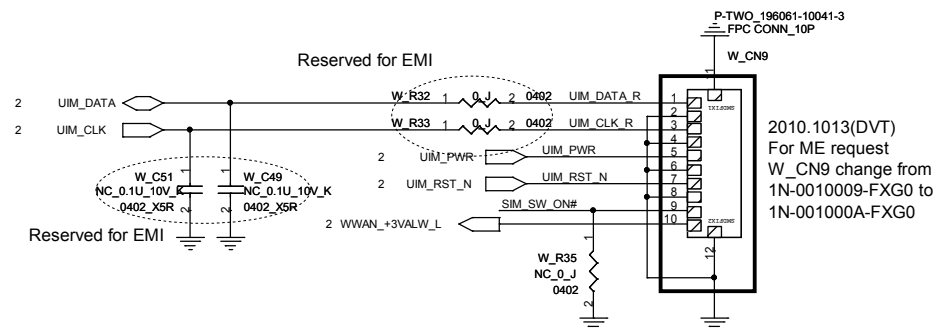

TO SIM DB

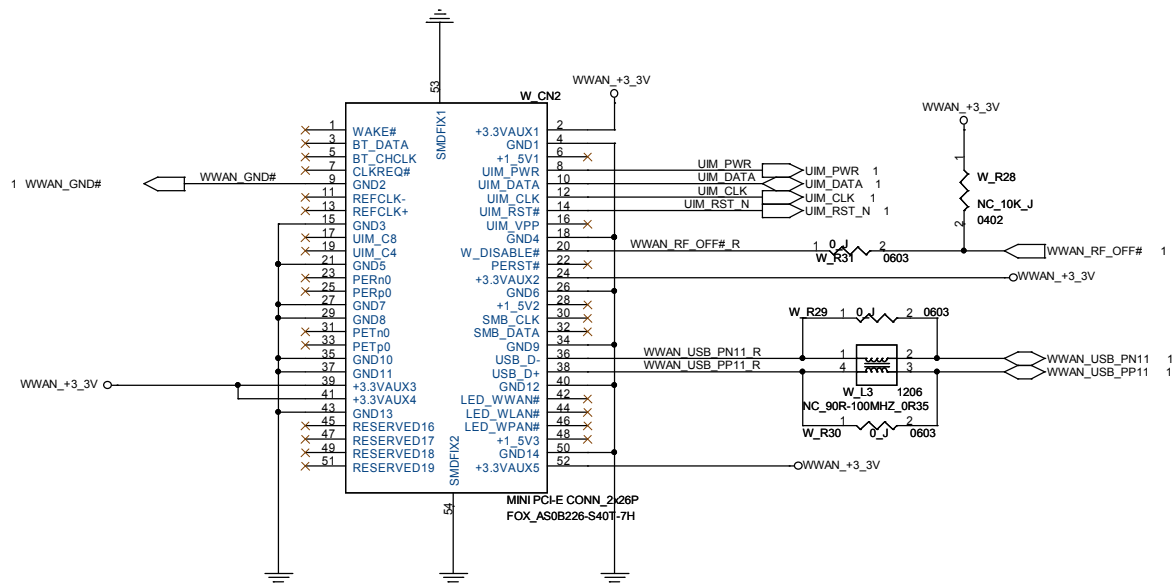

Add follow MOR request IRX-5580_Wireless-Schematics-Guideline_r050_100701_dist.pptx

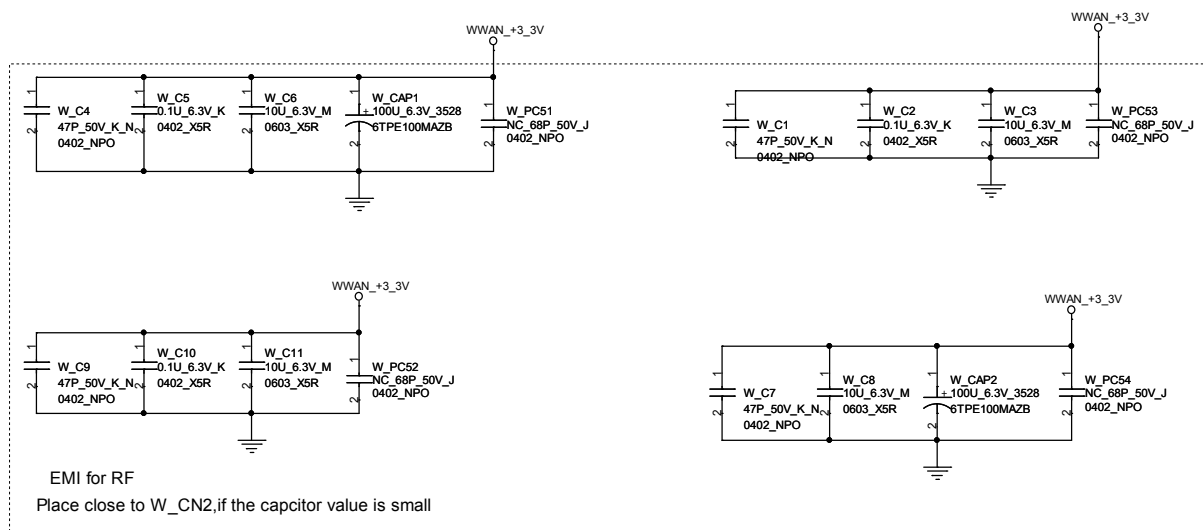

W_{L4} 60R 100mH2_0003

W_{C14} 7U 6.3V_K 0402_XSR

W_{C15} 7U 6.3V_K 0003_XSR

W_{C16} NC 33P 50V_J 0402_NPO

W_{C17} 0.1U 10V_K 0402_XSR

W_{C18} 0.1U 10V_K 0402_XSR

W_{C19} 0.1U 10V_K 0402_XSR

W_{C20} 0.1U 10V_K 0402_XSR

W_{C21} 0.1U 10V_K 0402_XSR

W_{C22} 0.1U 10V_K 0402_XSR

W_{C23} NC 0.1U 10V_K 0402_XSR

+VDD33_LAN 500mA

For GLAN

add one 0.1uF capacitor

Close to pin 34,35 of U40

AVDD33_REG

W_{C24} 0.1U 10V_K 0402_XSR

W_{C25} 7U 6.3V_K 0003_XSR

W_{R7.1} 2.0J 0003

Close to pin 21 or U40

W_R8 1 2 0 J

W_C26 1 7U_8.3V_K 0603_XGR

W_C27 1 7U_10V_K 0402_XGR

W_C30 1 7U_10V_K 0402_XGR

W_C31 1 7U_10V_K 0402_XGR

W_C32 1 7U_10V_K 0402_XGR

W_C33 1 7U_10V_K 0402_XGR

W_C34 1 33P_50V_J 0402_NFO

W_C35 1 7U_10V_K 0402_XGR

W_C36 1 7U_10V_K 0402_XGR

W_C37 1 7U_10V_K 0402_XGR

W_R9 1 2 0602 -O+VDD33_LAN

W_R10 1 2 0402



[illegible]

Using eFUSE without ASF
For RTL8111E mounted R16&R17

2010.10.16 /
For crystal clock issue
W_C44,W_C45 change
from 27pF to 22pF

2010.11.21
For SI crystal test fail
W_C44,W_C45 change
from 22pF(1C-2N20220-J000)
to 12pF(1C-2N20120-K000)

2010.12.24
Adapter ISN EMI test fail change W_C84 from
1500pF to 100pF

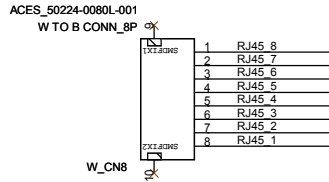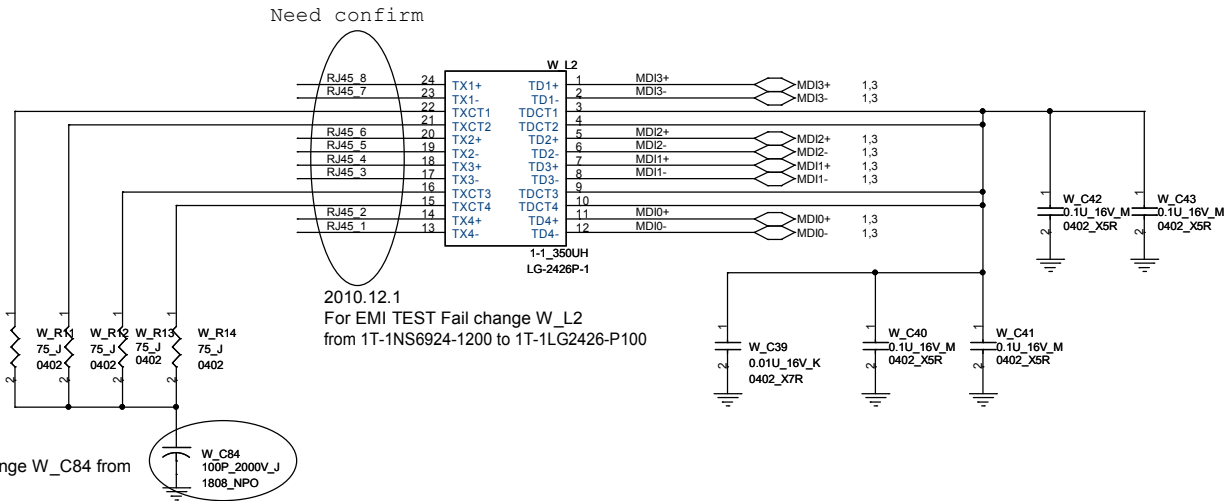

RJ45

2010.12.27
For PVT charger LED Blinking issue
W_PR9 pull high to +3VALW
W_R23 change to 300K(1R-000304-F200)

2010.11.30

For power request delete W_PQ17
W_PR9 change from 300K
to 47K, W_PR28 from 62K to 47K

5A

TP406

tpc40b_75

DC_IN

W_PQ12

CH5205-30PT

W_PQ13

CH5205-30PT

W_PQ14

CH5205-30PT

W_PQ15

CH5205-30PT

W_PQ16

CH5205-30PT

W_PQ17

CH5205-30PT

W_PQ18

CH5205-30PT

W_PQ19

CH5205-30PT

W_PQ20

CH5205-30PT

W_PQ21

CH5205-30PT

W_PQ22

CH5205-30PT

W_PQ23

CH5205-30PT

W_PQ24

CH5205-30PT

W_PQ25

CH5205-30PT

W_PQ26

CH5205-30PT

W_PQ27

CH5205-30PT

W_PQ28

CH5205-30PT

W_PQ29

CH5205-30PT

W_PQ30

CH5205-30PT

W_PQ31

CH5205-30PT

W_PQ32

CH5205-30PT

W_PQ33

CH5205-30PT

W_PQ34

CH5205-30PT

W_PQ35

CH5205-30PT

W_PQ36

CH5205-30PT

W_PQ37

CH5205-30PT

W_PQ38

CH5205-30PT

W_PQ39

CH5205-30PT

W_PQ40

CH5205-30PT

W_PQ41

CH5205-30PT

W_PQ42

CH5205-30PT

W_PQ43

CH5205-30PT

W_PQ44

CH5205-30PT

W_PQ45

CH5205-30PT

W_PQ46

CH5205-30PT

W_PQ47

CH5205-30PT

W_PQ48

CH5205-30PT

W_PQ49

CH5205-30PT

W_PQ50

CH5205-30PT

W_PQ51

CH5205-30PT

W_PQ52

CH5205-30PT

W_PQ53

CH5205-30PT

W_PQ54

CH5205-30PT

W_PQ55

CH5205-30PT

W_PQ56

CH5205-30PT

W_PQ57

CH5205-30PT

W_PQ58

CH5205-30PT

W_PQ59

CH5205-30PT

W_PQ60

CH5205-30PT

W_PQ61

CH5205-30PT

W_PQ62

CH5205-30PT

W_PQ63

CH5205-30PT

W_PQ64

CH5205-30PT

W_PQ65

CH5205-30PT

W_PQ66

CH5205-30PT

W_PQ67

CH5205-30PT

W_PQ68

CH5205-30PT

W_PQ69

CH5205-30PT

W_PQ70

CH5205-30PT

W_PQ71

CH5205-30PT

W_PQ72

CH5205-30PT

W_PQ73

CH5205-30PT

W_PQ74

CH5205-30PT

W_PQ75

CH5205-30PT

W_PQ76

CH5205-30PT

W_PQ77

CH5205-30PT

W_PQ78

CH5205-30PT

W_PQ79

CH5205-30PT

W_PQ80

CH5205-30PT

W_PQ81

CH5205-30PT

W_PQ82

CH5205-30PT

W_PQ83

CH5205-30PT

W_PQ84

CH5205-30PT

W_PQ85

CH5205-30PT

W_PQ86

CH5205-30PT

W_PQ87

CH5205-30PT

W_PQ88

CH5205-30PT

W_PQ89

CH5205-30PT

W_PQ90

CH5205-30PT

W_PQ91

CH5205-30PT

W_PQ92

CH5205-30PT

W_PQ93

CH5205-30PT

W_PQ94

CH5205-30PT

W_PQ95

CH5205-30PT

W_PQ96

CH5205-30PT

W_PQ97

CH5205-30PT

W_PQ98

CH5205-30PT

W_PQ99

CH5205-30PT

W_PQ100

CH5205-30PT

W_PQ101

CH5205-30PT

W_PQ102

CH5205-30PT

W_PQ103

CH5205-30PT

W_PQ104

CH5205-30PT

W_PQ105

CH5205-30PT

W_PQ106

CH5205-30PT

W_PQ107

CH5205-30PT

W_PQ108

CH5205-30PT

W_PQ109

CH5205-30PT

W_PQ110

CH5205-30PT

W_PQ111

CH5205-30PT

W_PQ112

CH5205-30PT

W_PQ113

CH5205-30PT

W_PQ114

CH5205-30PT

W_PQ115

CH5205-30PT

W_PQ116

CH5205-30PT

W_PQ117

CH5205-30PT

W_PQ118

CH5205-30PT

W_PQ119

CH5205-30PT

W_PQ120

CH5205-30PT

W_PQ121

CH5205-30PT

W_PQ122

CH5205-30PT

W_PQ123

CH5205-30PT

W_PQ124

CH5205-30PT

W_PQ125

CH5205-30PT

W_PQ126

CH5205-30PT

W_PQ127

CH5205-30PT

W_PQ128

CH5205-30PT

W_PQ129

CH5205-30PT

W_PQ130

CH5205-30PT

W_PQ131

CH5205-30PT

W_PQ132

CH5205-30PT

W_PQ133

CH5205-30PT

W_PQ134

CH5205-30PT

W_PQ135

CH5205-30PT

W_PQ136

CH5205-30PT

W_PQ137

CH5205-30PT

W_PQ138

CH5205-30PT

W_PQ139

CH5205-30PT

W_PQ140

CH5205-30PT

W_PQ141

CH5205-30PT

W_PQ142

CH5205-30PT

W_PQ143

CH5205-30PT

W_PQ144

CH5205-30PT

W_PQ145

CH5205-30PT

W_PQ146

CH5205-30PT

W_PQ147

CH5205-30PT

W_PQ148

CH5205-30PT

W_PQ149

CH5205-30PT

W_PQ150

CH5205-30PT

W_PQ151

CH5205-30PT

W_PQ152

CH5205-30PT

W_PQ153



CH5205-30PT

W_PQ154

CH5205-30PT

W_PQ155

CH5205-30PT

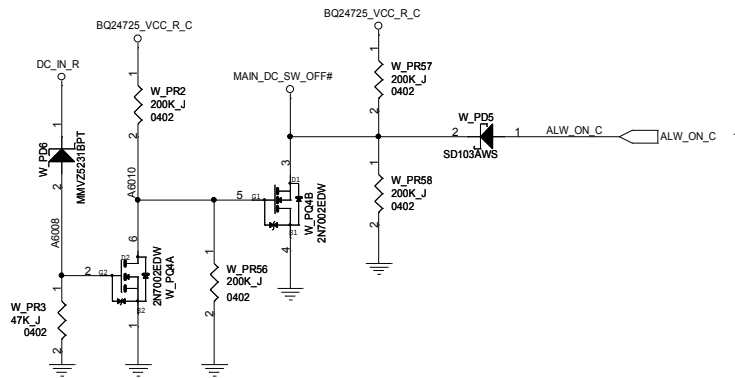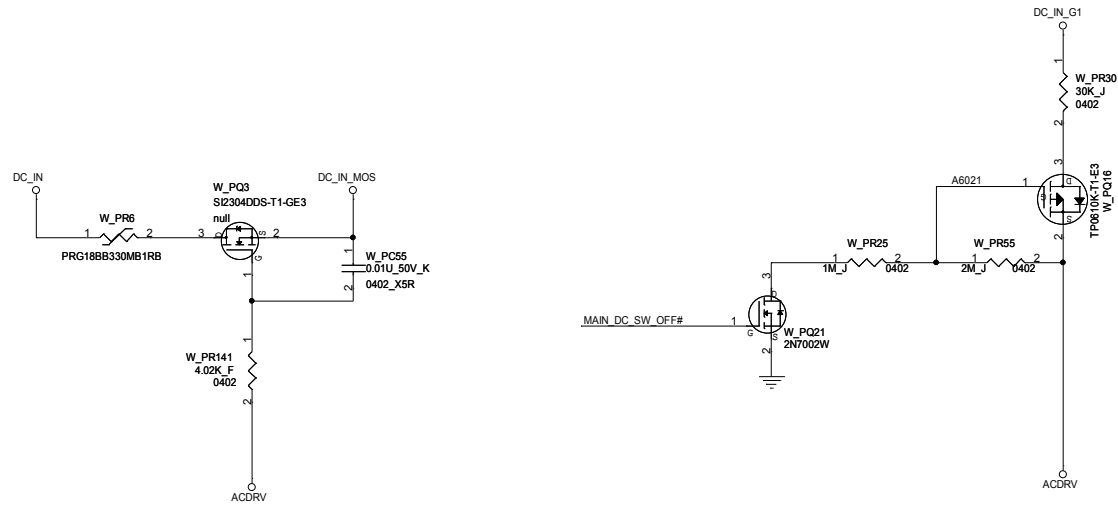

2010.11.25(PVT)
For cost reason Delete zero standby circuit W_PR45,W_PR50,W_PR53,W_PR43,W_PR44,W_PR52
W_PR62,W_PR41,W_PR63,W_PR61,W_PC39,W_PU5,W_PU3,W_PQ19,W_PQ18

10/08/21 Modify SCP circuit.

(2010/04/04)
P.03 {DCIN&Charger} Change the charger IC from OZ864LN to BQ24725RGRR.
P.04 {OVP protection} Delete OVP circuit because of bq24725 also had this function.
P.04 {OVP protection} Add W_PQ7A,W_PQ7B,W_PR138,W_PR140 for level shift following the design variation.

(2010/04/25)
P.01 {Mini-Card 3G} Delete W_CN3. W_CN1 pin 7/8 add net USB_SIM+/USB_SIM-
P.02 {BTB CONN DB} Change a USB3.0 port to a PCIE port

(2010/04/26)
P.01 {Mini-Card 3G} Unify all ground to Ch_GND for layout conveniency.
P.02 {BTB CONN DB} Unify all ground to Ch_GND for layout conveniency.
P.03 {DCIN&Charger} unify all ground to Ch_GND for layout conveniency.
P.03 {DCIN&Charger} Change the size of W_PR23 from 0402 to 0603.
P.03 {DCIN&Charger} Add W_PU1 for dual battery select.
P.04 {OVP protection} Unify all ground to Ch_GND for layout conveniency.

(2010/05/03)
P.05 {BTB CONN DB} Add LED DB CONN and LED control circuit

(2010/05/04)
P.05 {BTB CONN DB} Move LED DB CONN and LED control circuit to MB side

P.01 {Mini-Card 3G} Change W_CN2 to 1N-1052000-0000

(2010/05/10)
P.02 {BTB CONN DB} For MOR request change DOCKKONG connector from 74 pins to 54 pins,the connector HHP/N change from 1N-0070000-M0G0 to 2N-0054000-MKG0
P.03 Power add W_PR8
P.03 follow Connector list W_CN1 change from 1N-0006004-FKG0 to 1N-0006007-FKG0
P.04 Add W_PU3,W_PQ10,W_PQ12,W_PC39 and change W_PR141 to W_PD3 for Zero Standby requirement.

P.02 USB3.0 HOST change to USB HUB delete W_PR_PLT_RST#
P.02 Docking connector to RJ45 connector delete W_PR_CLK_REQ_LAN#

(2010/05/11)
P.02 W_CN7 add pin5 for WWAN +3VALW power

P.04 W_PC39 DC rated voltage change from 6.3V to 10V

(2010/05/12)
P.01,P.02 W_CN2 Pin20 signal change from WWAN_EN to WWAN_RF_OFF#

P.01 follow layout request W_CN1 change from 1N-0006007-FKG0 to 1N-0006004-FKG0

P.02 Docking CN follow EMI request update pin define

(2010/05/14)
P.02 Docking DB use WWAN_PWREN&WWAN_RF_OFF# W_CN5 add WWAN_RF_OFF# signal
P.02 For EMI W_CN5 pin define updated
P.03 Change W_PQ81,WPQ82 from Si7326DN-T1-GE3 to IRFH3707TRPbF for large current require.
P.03 Change W_PD2 from UMN11N to two pcs CH520S-30PT for large current require.
P.03 Change W_PR5 from 10_F_1206 to 10_J_1206 for cost down.
P.03 Change W_Pf2 from 0429007.WRML to 0437007.WR for PUR request.
P.03 Change W_PR11 from 0_J_0402 to 0_J_0603.
P.03 Change W_PC18 from C1005X7R101KGT to CC0402JRNPO9BN101 for PUR suggest.
P.04 Power change W_PQ3&W_PC39

(2010/05/15)
P.03 Change W_PQ5,W_PQ6 from 2N7002W to 2N7002ESPT for PUR suggest.
P.03 Add SMBUS selete circuit for MOR request

(2010/05/18)
P.03 Change signal SELECT_BAT_A/B_C to BATT1/2_EN_C
P.03 W_PR38&W_PR39 change from NC to stuff

(2010/05/19)
P.03 Change PC1,PR1 to W_PC1,W_PR1
P.01 For ME request change W_CN7 from 1N-0007001-FKG0 to 1N-0014004-FKG0

(2010/05/20)
P.03 Re-net W_PQ8,W_PQ9,W_PR26,W_PR33,W_PR27.
P.03 Stuff W_FR38,W_FR39.
P.03 Change net EC_IOUT_C to EC_IADAPT_C.

P.03 Incorporate the SMBus BQ24725_SDA_SMB_C,BQ24725_SCL_SMB_C to DAT_SMB_C,CLK_SMB_C

P.03 Change W_PQ1,W_PQ2 from 2N7002DW to 2N7002EDW for PUR suggest.

P.03 Change W_PC4 from 0402B105K500CT to UMK212BJ105KG-T for PUR suggest.

P.03 Add W_PR9,W_PC40,W_PU5 for battery discharge current sense.

P.03 Change W_PD5 and W_PD30 from 1SS400PT to CH520S-30PT to optimize performance.

P.03 Change W_PQ4,W_PQ7 from 2N7002DW to 2N7002EDW for PUR suggest.

(2010/05/22)
P.03 For power request W_PC19 change from 0.1uF to 0.047uF

P.03 For power request W_PR23 change from 4.02Kohm to 8.06Kohm

(2010/05/24)
P.02 W_CN7 DCBATOUT Pin change from 6pins to 7 pins

P.02 For layout suggestion change W_CN4 from 2N-0054000-MKG0 to 1N-0060002-FXG0

(2010/05/26)
P.03 For MOR request change WWAN power add W_Q1,W_Q2,W_Q3

P.03 For MOR request add LAN and transformer on Docking DB

(2010/05/27)
P.04 For MOR request delete PLT_RST# pull high resistor W_R23

P.04 For MOR request change W_U2 power from WWAN +3VRUN to WWAN +3VSUS
P.07 For Power request change W_PD5,W_PD30 change from 16-CH520S3-0P00 to 16-SD103AW-S000

(2010/05/28)
P.04 For Layout request change transformer and RJ45 CN pin define

(2010/05/31)
P.02 LAN from Docking DB to Docking station signal change from RJ45 to MDI

(2010/06/01)
P.04/05 have changed GND to POWER GND
P.02 W_CN9 have changed from 8pin to 10pin
P.03 Follow MOR request for SIM CARD add W_Q6,W_C50,W_R23,W_R25,W_R26,W_R27
P.02 W_CN5 have changed from 70pin(1N-0070000-F0G0) to 80pin(1N-0080001-FWG0)
P.03 Follow MOR request add W_BOSS1,W_BOSS2 for WWAN

(2010/06/02)
P.02 For MOR request W_CN5 add GND pin between WWAN_USB and DAT_SMB
P.02/04 For MOR request change WWAN +3VSUS to W +3VSUS
P.06 Change W_PR1 from 649K to 162K for vendor suggest.
P.06 Change W_PR22 from 105K to 26.1K for vendor suggest.
P.06 Add W_PR9,W_PR28,W_PD8 for vendor suggest.
P.06 Change W_PQ84 from NTTFS4823NTWG to NTTFS4821NTAG.
P.06 Change W_PR4 from 4.02K to 8.2K for vendor suggest.
P.06 Delect battery discharge circuit, and change discharge from DCBATOUT to DC_IN_R.
P.06 Change W_PR23 from 8.06K_F to 8.2K_j for cost down.
P.06 Change net name EC_VADAPT_C,EC_IADAPT_C to EC_VDCBATOUT_C,EC_IDCBATOUT_C.
P.06 Change W_PR10,W_PR25 value for charge current change.
P.06 Add W_PR31,W_PR32,W_PQ13 for battery power switch.
P.07 Add W_PU5 to add ALW_ON control Zero Standby.

(2010/06/03)
P.03 For RF request W_C1,4,7,9 change from 1000pF to 47pF
P.02 Change W_CN4 pin define for layout

(2010/06/04)
P.06 Change W_PCN4 For ME request change to 1N-0011001-MKT0 W_PCN5 change to 2N-000700Y-MKG0

(2010/06/05)
P.02 Add W_CN3 for USB3.0 follow MOR requestion

(2010/06/07)
P.02 W_CN4 change to MOR request pin define
P.02 Add W_CN3 for MOR request sperated USB2.0 and USB3.0 signal

(2010/06/08)
P.06 change W_PN4,W_PN5 pin define for ME,Layout request
P.18 L_CN3 add L_LED_BRIGHTNESS signal
P.02 W_CN5 change from 1N-0080001-FWG0 to 1N-0080000-FKG0
P.02 W_CN9 change from 10pin to 12pin

(2010/06/09)
P.07 Add W_PR41 for power request
P.03 For WWAN power move to MB delete W_Q1,WQ2,W_Q3,W_R2,W_R3,W_R4,W_C12
P.02 Follow ME CN list W_CN4 change to 1N-0054000-FKCO

(2010/06/10)
P.06 For power request change W_PR29,W_PR30 from 10K to 100K
P.06 For power request add W_PR42

(2010/06/11)
P.02 Change W_CN4 pin define for USB3.0 layout
P.03 change W_BOSS1,W_BOSS2 follow ME connector list

(2010/06/12)
P.06 For RF request add W_PC40,W_PC42,W_PC43,W_PC44,W_PC45,W_PC46,
W_PC47,W_PC48,W_PC49 for EMI

(2010/06/14)
P.06 For power request change W_PR28 from 68K to 62K
P.06 For power request change EC_IDCBATOUT_C to IDCBATOUT_C
P.07 For power request add W_PR43,W_PR44,W_PR45
P.07 For power request W_PQ3 change to 17-S12303C-DS00

P.06 For MOR request rectify WWAN signal direction
P.06 change W_CN7 pin define consistent with MB
P.03 Follow MOR request add W_R28
(2010/06/15)
P.03 Follow MOR request add W_GP1
P.03 Follow MOR request add W_R29,W_R30 then c-lay with W_L3
P.02 Follow MOR request change W_CN5 pin78 to +3VRUN power
P.04 W_U4 pin26 pull high to +3VRUN power for save LAN CHIP power consumption
(2010/06/16)
P.02 M_CN3 have change follow ME connector list(from 1N-0004008-M1T0 to 1N-000400C-M1T0)
P.31 W_BOSS1,W_BOSS2 have change follow ME connector list(from 1M-1F40M20-1500 to 1M-1F75H45-1700)
P.03 Change W_GP1 to 0ohm W_R31
(2010/06/17)
P.06 Follow power request add 0ohm resistor W_PR48,W_PR49
P.06 Follow power request add 100Kohm resistor W_PR46,W_PR47
P.06 Follow power request W_PR659 change to 0.02ohm
(2010/06/18)
P.06 Follow power request delete W_PR25,W_PR32,W_PR31 change to 100K
P.06 Follow power request add W_PD9,W_PD10
(2010/06/21)
P.03 For RF request add W_PC51,W_PC52,W_PC53,W_PC54
P.31 Follow ME connector list W_BOSS1,W_BOSS2 change to 1M-1F40M20-1500
(2010/06/22)
P.02 Follow EMI suggestion add W_C38,W_C48,W_C52
P.02 Follow EMI suggestion add W_C49,W_C51,W_R22,W_R33
P.06 Follow EMI suggestion add W_PC50,W_PC55~W_PC59
P.02 Follow ME connector list change W_CN9 to 1N-0012007-FKT0
(2010/06/23)
P.06 For PCB space limited delete W_PC55
P.31 Delete W_BOSS2 follow ME DXF
P.03 Follow ME connector list W_CN2 change to 1N-0052005-F1G0
P.05 Add W_R34 for transformer power reserved
(2010/06/24)
P.05 Follow FAE suggestion change W_C25 to 4.7uF
P.02 Change W_CN4 power pin define follow MOR suggestion
P.05 Follow ME connector list change W_CN8 to 1N-0008002-MKT0
P.02 Follow MOR suggestion reserve USB3.0 CN then change connector
from 1N-000400C-M1T0 to 1N-0006009-FXT0
P.07 Follow power request change W_PR225 to 143k,change W_PR226 to 84.5K
P.07 Follow power request Add W_PR229 100K pull low resistor and Add W_PR228 100K resistor
P.04 Follow MOR request change W_R15,W_R16 to 100K
(2010/06/25)
P.02 Follow ME connector list W_CN7 change to 10pin(w_cn7)+6pin(w_cn10)
(2010/06/28)
P.02 W_CN9 change from 12pin to 10pin
P.06 W_PCN5 change to 2N-0004012-MKGO
P.06 Follow power request add power switch circuit
P.02 Delete W_CN3 and testpoint
(2010/06/29)
P.06 W_CN1 follow ME suggestion change from 19-MPU1018-1001 to 19-SPVM110-1000
P.07 Follow power request W_PU3,W_PU5 change to 14-SN74AHC-T113
P.02 W_CN9 follow ME suggestion change to 1N-0010001-F0T0
(2010/07/01)
P.02 For RF request change W_CN9 pin define
P.07 For power request change W_PQ35, W_PR230
(2010/07/02)
P.05 Testpoint change from 40mils to 20mils
P.05 Delete TOP side test point TP150~TP157
P.02 For MOR request delete SIM_HODER# signal
P.03 For MOR request delete W_Q6(17-2N7002E-SP00)
(2010/07/03)
P.06 For Power request W_PQ20 change to 17-SSM3K15-FL00
P.06 For layout request TP1216,TP1217 change from 40mils to 20mils
(2010/07/05)
P.02 For power request change W_CN7,W_CN10 pin define
P.06 For power request change add W_PD12
(2010/07/06)
P.05 For realtek suggestion transformar no need pull high delete W_R34
P.06 For power suggestion W_PR22 change to 71.5K
P.06 For power suggestion W_PD1 change to 16-SSM24GP-0000
P.07 For power suggestion add W_PR51,W_PR52,W_PR53
(2010/07/07)
P.06 For layout space W_PD1 change to 16-CH520S3-0P00
P.06 For power request add W_PR54,W_PR55
P.02 For ME request W_CN4 change to 1N-0054000-FKCO then change pin define
(2010/07/08)
P.02 For layout request change W_CN4 pin define
(2010/07/10)
P.02 For power request change power UVP circuit

(2010/07/12)
P.07 For power suggestion move power SCP circuit to MB
(2010/07/13)
P.06 For ME request W_PCN5 change from 2N-0004012-MKGO to 2N-0007013-MKGO
P.04 For EMI request add W_C50
(2010/07/14)
P.03 For MOR request add W_R34 pull high SIM_SW_ON# signal
P.04 For MOR request add W_R35
P.02 For ME request W_CN5 change from 1N-0080000-FKGO to 1N-0080000-F1G0
P.32 Follow ME connector list W_BOSS1 change to 1M-1F40M20-1502
P.02 For layout request W_CN5 change from 1N-0080000-F1G0 to 1N-0080000-FKGO
(2010/07/15)
P.02 For ME request W_CN5 change from 1N-0080000-FKGO to 1N-0080001-FKGO
P.02 For EMI request add W_C53
(2010/07/15)
P.07 For power request W_PR141 change to 100K,W_PC55 change to 0.47u
(2010/07/17)
P.03 Delete W_R34 for SIM_SW_ON# have been pull high on EC side
(2010/07/19)
P.02 change W_CN5 pin define
P.02 For MOR request change W_CN7 pin define
(2010/07/22)
P.32 For ME request add W_H6
P.32 Delete W_H1
EVT2
2010/08/03
P.32 [BOSS] Change follow ME connector list W_BOSS1 change from 1M-1F40M20-1502 to 1M-1F40H25-1500
2010/08/11
P.05 [Transformer] For layout request change MS/SD CN test point from 20mil to 40 mil
2010/08/13
P.08 [DB CN] Follow ME connector list M_CN7 change from 1N-0050004-FXT0 to 1N-0050006-FXT0
2010/08/16
P.06 [DCIN&Charger] Change W_PC585,W_PC584,W_PC601,W_PC602 from 1C-2B60106-K000 to 1C-2B70106-K400 for layout space limit requirement.
P.07[OVP] Change W_PR140 from 1R-0000103-F200 to 1R-0001622-F200.
2010/08/18
P.06 [DCIN&Charger] Change W_PR40 for power request
2010/08/20
P.32 [Boss Hole] For MOR request add W_BOSS2
For power request change

P.06 [DCIN&Charger] Add ACDRV power symbol.
P.06 [DCIN&Charger] Change W_PC19 from 0.047uF to 0.022uF.
P.06 [DCIN&Charger] Change W_PR4 from 8.2K to 4.02K.
P.06 [DCIN&Charger] Delect W_PR23.
P.06 [DCIN&Charger] Add W_PR51,W_PR54.
P.06 [DCIN&Charger] Separate battery A and battery B SYS_PR5# signal.
P.06 [DCIN&Charger] Move W_PQ20B and W_PR11 from MB to DB.
P.06 [DCIN&Charger] Change W_PD1,W_PD2,W_PD7 from SD103AWS to SMD24JGP.
2010/08/23
P.02 [DB CN] For ME request W_CN9 change from 1N-0010001-F0T0 to 1N-0010007-FXG0
P.02 [DB CN] W_CN5 change pin define
2010/08/25
P.32 [BOSS Hole] For the layout placing delete W_BOSS2
P.02 [DB CN] W_CN5 for ME request change from 1N-0080001-FKGO to 1N-0080002-FKGO
P.02 [DB CN] For ME request W_CN9 change from 1N-0010007-FXG0 to 1N-0010001-F0T0
P.02 [DB CN] W_CN5 change pin define
2010/08/26
P.06 [DCIN&Charger] W_PQ20 change from 17-2N7002E-DW00 to 17-SSM6N15-AF00
P.02 [DB CN] W_CN5 for EMI request add W_R54,W_R55,W_R56,W_R57
DVT
2010/09/07
P.07 [OVP] W_PQ3 for PUR suggestion change from 17-S12306B-DS00 to 17-S12304D-DS00
2010/09/16
P.06 [DCIN&Charger] For power request W_PD1,W_PD2,W_PD7 change to 16-CH651L4-0G00
P.06 [DCIN&Charger] For power request add W_PR64,W_PR65
P.02 [DB CN] For ME request W_CN9 change from 1N-0010001-F0T0 to 1N-0010009-FXG0
2010/10/07
P.06 [DCIN&Charger] For RF request delete W_PC47,W_PC48,W_PC49
P.06 [DCIN&Charger] MOR request add W_PR66~W_PR69
2010/10/13
P.05 [DCIN&Charger] For ME request W_CN9 change from 1N-0010009-FXG0 to 1N-001000A-FXG0
2010/10/14
P.01 [DB CN] For EMI request add W_C58,W_C59
2010/10/18
P.06 [DCIN&Charger] For power request add W_PR64,W_PR65
2010/10/19
P.02 [Mini card 3G] W_CAP1,W_CAP2 100uF change to 220uF

54321

2010/10/19

P.01 [DB CN] For PUR suggestion W_C54,W_C55,W_C56,W_C57,W_C58,W_C59 change from 1C-2N20150-J300 to 1C-2N20150-K000

PVT

2010/11/02

P.06 [DCIN&Charger] For power request W_PR64 change from 10K to 470K

P.06 [DCIN&Charger] For power request add W_PR70

2010/11/18

P.06 [DCIN&Charger] For power request Add W_PQ7,W_PR71,W_PR72 for adapter protect

2010/11/18

P.03 [LAN] For SI crystal test fail W_C44,W_C45 change from 22pF(1C-2N20220-J000) to 12pF(1C-2N20120-K000)

2010/11/25

P.06 [DCIN&Charger] For power request add W_PR48,W_PR49,W_PR23,W_PR51,W_PR54,W_PR27 change to GAP

P.07 [OVP] For cost reason Delete zero standby circuit W_PR45,W_PR50,W_PR53,W_PR43,W_PR44,W_PR52

W_PR62,W_PR41,W_PR63,W_PR61,W_PC39,W_PU5,W_PU3,W_PQ19,W_PQ18

2010/11/29

P.06 [DCIN&Charger] For power request add W_PQ17 W_R23

P.01 [DB CN] W_CN5 pin42 for power request change from AC_OFF_EC# to +3VALW

2010/11/30

P.01 [DB CN] For EMI request W_C53 change from NC to mount,add W_C60

P.06 [DCIN&Charger] For power request delete W_PQ17,W_PR9 change from 300K to 47K,W_PR28 from 62K to 47K

P.06 [DCIN&Charger] For power request add W_PC47,W_PC48

P.06 [DCIN&Charger] For power request add W_PR23,W_PR27

2010/12/1

P.04 [Transformer] For EMI TEST Fail change W_L2 from 1T-1NS6924-1200 to 1T-1LG2426-P100

MP

2010/12/27

P.06 [DCIN&Charger] For PVT charger LED Blinking issue Delete W_PR9 Add W_R23 1R-0000304-F200

Change W_PR28 from 1R-0000473-F200 to 1R-0000623-F200

P.06 [DCIN&Charger] For PVT charger LED Blinking issue power request W_PR9 pull hight to +3VALW W_R23 change to 300K(1R-0000304-F200)

2010/12/27(2)

P.01 [DB CN] Due to SI overload test result W_F1 change from 1M-F32V2A0-F000 to 1M-F32V0A5-F002

2011/01/04

P.01 [DB CN] For SI overload test fail add W_F2(1M-F32V1A5-F003)

